


TOP NOTCH 2 INSTALLATION

Components & Hardware

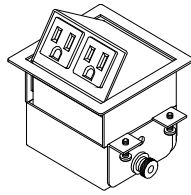

(A) Top Notch 2
Qty 1

Tools Needed



For use with:

Table thicknesses between .75" – 1.88"

- 1- Provide cutout, as shown, at location Top Notch 2 (A) will be mounted. Note: Shaded area to be recessed down .062"
- 2- Remove thumbnut, washer, threaded stud and clamp from each side of Top Notch 2. Set parts aside for use later. Do not remove screws from clamps, however unscrew them until they are almost removed
- 3- Insert Top Notch 2 into cutout from top. Be sure bezel sits down into recessed area so top of bezel is flush with top of work surface.
- 4- From underside of work surface insert threaded studs, clamps, washers and thumb nuts, removed in Step 2, onto Top Notch 2 as shown. Note: Use lower hole in clamp for .75" – 1.25" thick tables and upper hole for 1.25" – 1.88" thick tables. Tighten thumb nut until clamp is tight on Top Notch 2.
- 5- Once clamps are installed and secure tighten down tightening screws against underside of work surface until Top Notch 2 is secure.
- 6- Plug in power cord and connect any data cables as required.

